



**MOTOROLA**

Semiconductor Products Sector

Order Number: MPC107UMAD/D

Rev. 0, 2/2001

---

# ***PowerPC***<sup>TM</sup>

## **Errata to MPC107 PCI Bridge/Memory Controller User's Manual, rev. 0**

This errata describes corrections to the *MPC107 PCI Bridge/Memory Controller User's Manual*, rev 0. For convenience, the section number and page number of the errata item in the user's manual are provided.

To locate any published updates for this document, refer to the world-wide web at <http://www.mot.com/powerpc>.

2.1.2, 2-7

In Table 2–2, the state of the  $\overline{\text{INT}}$  signal during reset should read as follows:

**Table 2–2. Output Signal States During System Reset**

Interface	Signal	State During System Reset
—	—	—
EPIC control	$\overline{\text{INT}}$	Driven (unknown until $\overline{\text{HRESET}}$ is negated), then negated.
—	—	—

3.1, 3–2

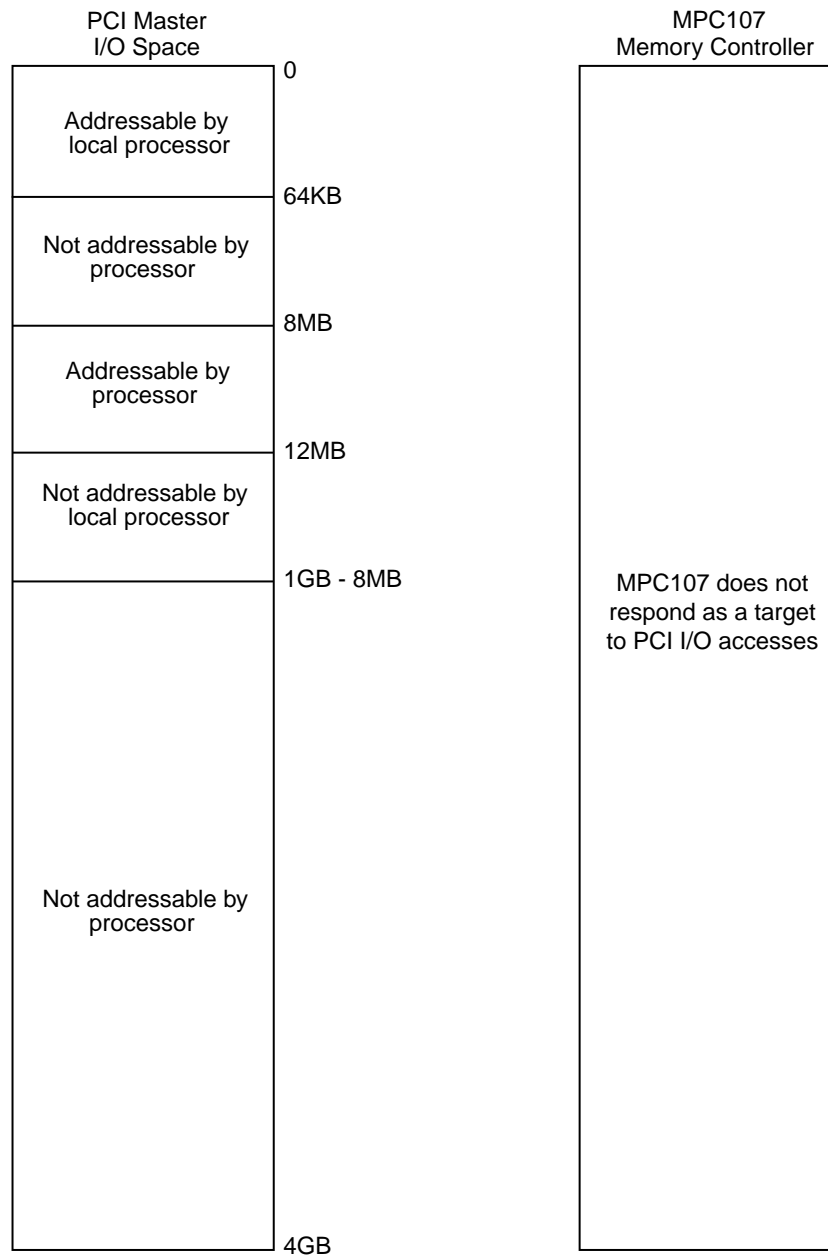
In Table 3–1, the PCI address range for the processor address range 8000\_0000 through FDFF\_FFFF should read as follows:

**Table 3–1. Address Map B—Processor View in Host Mode**

Processor Address Range				PCI Address Range	Definition
Hex		Decimal			
—	—	—	—	—	—
8000_0000	FDFF_FFFF	2G	4G - 32M - 1	8000_0000–FDFF_FFFF	PCI memory space <sup>3</sup>
—	—	—	—	—	—

3.1, 3-7

Replace Figure 3-3 with the following:

**Figure 3-3. PCI I/O Master Address Map B**

4.1, 4–7

The reset value for the MCCR4 register should read as follows:

**Table 4–2. MPC107 Configuration Registers Accessible from the Processor**

Address Offset	Register	Size	Program Access Size (Bytes)	Access	Reset Value
—	—	—	—	—	—
0xFC	MCCR4	4 bytes	1, 2, or 4	Read/Write	0x0010_0000
—	—	—	—	—	—

4.7, 4–33

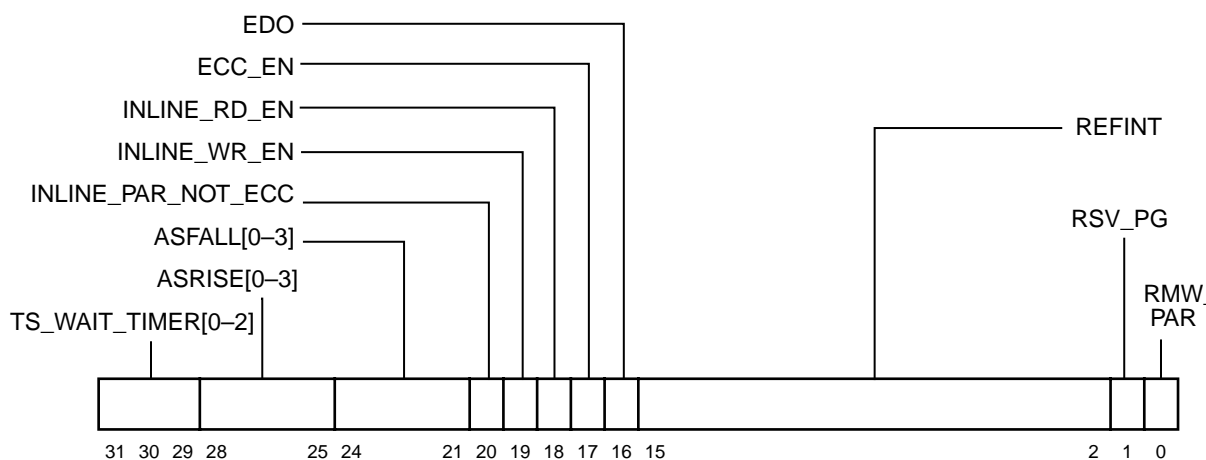
In Table 4–28, replace the name and description of the setting for bit 29 with the following:

**Table 4–28. Bit Settings for PICR2—0xAC**

Bits	Name	Reset Value	Description
29	SERIALIZE_ON_CFG	0	<p>This bit controls whether the MPC107 serializes configuration writes to PCI devices from the processor. Note that the sense of this bit is the opposite of that on the MPC8240.</p> <p>0 Configuration writes to PCI devices from the processor do not cause serialization. The internal buffers are not flushed.</p> <p>1 Configuration writes to PCI devices from the processor cause the MPC107 to serialize and flush the internal buffers.</p>

4.10, 4–47

Replace Figure 4–30 with the following. Note the name change to bit 18.

**Figure 4–30. Memory Control Configuration Register 2 (MCCR2)—0xF4**

4.10, 4–48

In Table 4-40, replace the “Wait States for ROM High Impedance” table in the description for bits 31–29 with the following. Note the addition of rows for 011 and 110.

**Table4–40. Bit Settings for MCCR2–0xF4**

Bits	Name	Reset Value	Description																																								
31–29	TS_WAIT_TIMER[0–2]	000	<p>Transaction start wait states timer. The minimum time allowed for ROM/Flash/Port X devices to enter high impedance is 2 memory system clocks.</p> <p>TS_WAIT_TIMER[0–2] adds wait states before the subsequent transaction starts in order to account for longer disable times of a ROM/Flash/Port X device. This delay is enforced after all ROM and Flash accesses, delaying the next memory access from starting (for example, DRAM after ROM access, SDRAM after Flash access, ROM after Flash access).</p> <p>Note that this parameter is supported for SDRAM systems only. For EDO/FPM DRAM systems, TS_WAIT_TIMER[0–2] must = 000.</p> <table border="1"> <thead> <tr> <th>Bits</th><th colspan="3">Wait States for ROM High Impedance</th></tr> <tr> <th></th><th>Reads with wide data path (32 or 64-bit)</th><th>Reads with gather data path in flow-through or registered buffer mode (8, 16, 32-bit)</th><th>All writes<sup>1,2</sup> and reads with gather data path in in-line buffer mode (8, 16, 32,-bit)</th></tr> </thead> <tbody> <tr> <td>000</td><td>2 clocks</td><td>5 clocks</td><td>6 clocks</td></tr> <tr> <td>001</td><td>2 clocks</td><td>5 clocks</td><td>6 clocks</td></tr> <tr> <td>010</td><td>3 clocks</td><td>5 clocks</td><td>6 clocks</td></tr> <tr> <td>011</td><td>4 clocks</td><td>5 clocks</td><td>6 clocks</td></tr> <tr> <td>100</td><td>5 clocks</td><td>6 clocks</td><td>7 clocks</td></tr> <tr> <td>101</td><td>6 clocks</td><td>7 clocks</td><td>8 clocks</td></tr> <tr> <td>110</td><td>7 clocks</td><td>7 clocks</td><td>7 clocks</td></tr> <tr> <td>111</td><td>8 clocks</td><td>9 clocks</td><td>10 clocks</td></tr> </tbody> </table> <p>Note 1. In this context, Flash writes are defined as any write to <math>\overline{RCS0}</math> or <math>\overline{RCS1}</math>.</p> <p>Note 2: For Flash writes, add the write recovery time, ROMNAL, to the given wait states for ROM high-impedance time.</p>	Bits	Wait States for ROM High Impedance				Reads with wide data path (32 or 64-bit)	Reads with gather data path in flow-through or registered buffer mode (8, 16, 32-bit)	All writes <sup>1,2</sup> and reads with gather data path in in-line buffer mode (8, 16, 32,-bit)	000	2 clocks	5 clocks	6 clocks	001	2 clocks	5 clocks	6 clocks	010	3 clocks	5 clocks	6 clocks	011	4 clocks	5 clocks	6 clocks	100	5 clocks	6 clocks	7 clocks	101	6 clocks	7 clocks	8 clocks	110	7 clocks	7 clocks	7 clocks	111	8 clocks	9 clocks	10 clocks
Bits	Wait States for ROM High Impedance																																										
	Reads with wide data path (32 or 64-bit)	Reads with gather data path in flow-through or registered buffer mode (8, 16, 32-bit)	All writes <sup>1,2</sup> and reads with gather data path in in-line buffer mode (8, 16, 32,-bit)																																								
000	2 clocks	5 clocks	6 clocks																																								
001	2 clocks	5 clocks	6 clocks																																								
010	3 clocks	5 clocks	6 clocks																																								
011	4 clocks	5 clocks	6 clocks																																								
100	5 clocks	6 clocks	7 clocks																																								
101	6 clocks	7 clocks	8 clocks																																								
110	7 clocks	7 clocks	7 clocks																																								
111	8 clocks	9 clocks	10 clocks																																								

7.4, 7–19

In the bulleted list beneath the sentence “As a target, the MPC107 responds to a transaction with a retry due to the following,” the fourth item should read as follows:

A configuration write to a PCI device is underway and  
 PICR2[SERIALIZE\_ON\_CFG] = 1.



8.7.2, 8–19

In Table 8–4, replace the description for bit 1 with the following:

**Table 8–4. DSR Field Descriptions—Offsets 0x104, 0x204**

Bits	Name	Reset Value	R/W	Description
—	—	—	—	—
1	EOSI	0	R/W Write1 clears	End-of-segment interrupt 0 No end-of-segment condition. When this bit is set, it can only be cleared by writing a 1 to it or by a hard reset. 1 After the block of data has finished transferring, this bit is set. If CDAR[EOSIE] = 1, an interrupt is generated. Otherwise, no interrupt is generated.

12.1.2.1, 12–4

Replace the third paragraph of section 12–4 with the following paragraph. The only change occurs in the fourth sentence.

When the processor requests data from PCI space, the data received from PCI is stored in the PRPRB until all requested data has been latched. The CCU does not terminate the address tenure of the internal transaction until all requested data is latched in the PRPRB. If the PCI target disconnects in the middle of the data transfer and an alternate PCI master acquires the bus and initiates a local memory access, the CCU retries the ongoing transaction with the processor so that the incoming PCI transaction can be snooped. A PCI-initiated access to local memory may require a snoop transaction on the 60x bus and also a copyback. The CCU does not provide the data to the 60x bus (for the processor to PCI read transaction) until all outstanding snoops for PCI writes to local memory have completed.

13.3, 13–6

Replace the last sentence in the first paragraph of section 13.3 with the following. Note the different ErrDR2 bits.

(The error detection bits are specifically bits 15, 13, and 12 in the PCI status register, bits 7–4 and 2–0 in ErrDR1, bits 6, 3, 2, and 0 in ErrDR2, and bits 8, 7, and 4 in the IMISR.)

B.1, B–1

Replace the final paragraph of section B–1 with the following:

In addition, the PCI bus uses a bit format where the most-significant bit (msb) for data is AD31, while the 60x data bus use a bit format where the msb is DH0. Thus, PCI data bit AD31 equates to the processor's data bits DH0 and DL0, while PCI data bit AD0 equates to the processor's data bits DH31 and DL31.

**Section #/Page #****Changes**

B.3, B-3

Replace the final paragraph on page B-3 with the following:

Note that the MSB on the 60x bus, D0, is placed on byte lane 0 (AD[7-0]) on the PCI bus. This occurs so D0 appears at address 0xnnnn\_nn00 and not at address 0xnnnn\_nn03 in the PCI space.



DigitalDNA is a trademark of Motorola, Inc.

The PowerPC name, the PowerPC logotype, and PowerPC 603e are trademarks of International Business Machines Corporation used by Motorola under license from International Business Machines Corporation.

Information in this document is provided solely to enable system and software implementers to use PowerPC microprocessors. There are no express or implied copyright licenses granted hereunder to design or fabricate PowerPC integrated circuits or integrated circuits based on the information in this document.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters can and do vary in different applications. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part.

Motorola and  are registered trademarks of Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

**Motorola Literature Distribution Centers:**

**USA/EUROPE:** Motorola Literature Distribution; P.O. Box 5405; Denver, Colorado 80217; Tel.: 1-800-441-2447 or 1-303-675-2140;  
World Wide Web Address: <http://lhc.nmd.com/>

**JAPAN:** Nippon Motorola Ltd SPD, Strategic Planning Office 4-32-1, Nishi-Gotanda Shinagawa-ku, Tokyo 141, Japan Tel.: 81-3-5487-8488

**ASIA/PACIFIC:** Motorola Semiconductors H.K. Ltd Silicon Harbour Centre 2, Dai King Street Tai Po Industrial Estate Tai Po, New Territories, Hong Kong

**Technical Information:** Motorola Inc. SPS Customer Support Center 1-800-521-6274; electronic mail address: [crc@wmkmail.sps.mot.com](mailto:crc@wmkmail.sps.mot.com).

**Document Comments:** FAX (512) 933-2625, Attn: RISC Applications Engineering.

**World Wide Web Addresses:** <http://www.motorola.com/PowerPC>  
<http://www.motorola.com/netcomm>  
<http://www.motorola.com/Coldfire>



**MOTOROLA**

MPC107UMAD/D